


## 2- Straight connector or coupling

**NOTE :**

1. (?) --> HDG: Hot dip galvanized  
CG: Cold galvanized

2.(A-B-C)--> A: PG  
B: NPT  
C: ISO METRIC

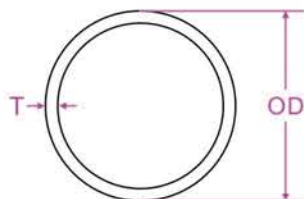

P(A-B-C)2-S-HDG

### PA: (PG)

ORDER CODE	SIZE PG	T mm	OD mm	L mm
PA 2 - 11 - ?	11	1	20	30
PA 2 - 13.5 - ?	13.5	1	22	30
PA 2 - 16 - ?	16	1	24	30
PA 2 - 21 - ?	21	1	30	35
PA 2 - 29 - ?	29	1.5	40	40
PA 2 - 36 - ?	36	1.5	50	50
PA 2 - 48 - ?	48	1.5	63	60



PA2-S-CG

### PB: (NPT-BSPT)

ORDER CODE	SIZE inch	T mm	OD mm	L mm
PB2-1/2 T-HDG	1/2"	2.5	25.65	30
PB2-3/4 T-HDG	3/4"	2.5	31.75	30
PB2-1 T-HDG	1"	3	39.5	40
PB2-1 1/4 T-HDG	1 1/4"	3	48	50
PB2-1 1/2 T-HDG	1 1/2"	3.5	55.3	60
PB2-2 T-HDG	2"	4	68.4	60
PB2-2 1/2 T-HDG	2 1/2"	4	81	70
PB2-3 T-HDG	3"	5	99	80
PB2-4 T-HDG	4"	5	124.4	100
PB2-5 T-HDG	5"	5.5	152.4	100



Connection Example

### PC: (ISO METRIC)

ORDER CODE	SIZE mm	T mm	OD mm	L mm
PC2-20 T-HDG	20	2	24	30
PC2-25 T-HDG	25	2	29	30
PC2-32 T-HDG	32	2.5	37	40
PC2-40 T-HDG	40	2.5	45	40
PC2-50 T-HDG	50	3.5	57	50
PC2-63 T-HDG	63	3.5	70	60
PC2-75 T-HDG	75	5	85	60
PC2-90 T-HDG	90	5	100	70
PC2-100 T-HDG	100	6	112	70

